KILBURN, LONDON NW6 2QX

TEL: 0207 3722222 FAX: 0207 3727464

Assessment Number: MF003949 Full Report

Version: admirecv/2 Printed: 02/05/2015

Summary Information

Claim

Authorisation Status: Work Provider: Claim Reference: Policy Number:

Other Reference:

Total Loss Admiral 105080333 Date of Incident: Able to Authorise Repairs: Repairs Authorised? **TBA**

VAT Portion Payable: Repairer: Estimated Repair Time

(Working Days):

30/04/2015 **TBA**

NonTaxable Approved 5.0

Vehicle Details

Vehicle

Manufacturer: Model: Model Sheet Number: Engine: Registration Number:

VIN Number: Registration Month: Registration Year: Odometer: Colour:

Paint Code: Build Date: Selection Type: **VOLKSWAGEN**

GOLF SE 657

1.9 LTR 77 KW RO56NPN WVWZZZ1KZ7B011141

September 2006 69169 miles **SILVER**

A7W

FROM 06/2006 AudaVIN+

Model Specs

5-DOOR FROM 06/2006 CLIMATIC VALEO INS PANEL COOLER BOX

RAIN SENSOR **ELECTRIC WINDOWS** ELEC FOLD DR MIRRORS AUTO DIPPING MIRROR

8 SPEAKER RADIO RCD 300 LIGHT SWITCHING AUTO

HEIGHT ADJ PASS SEAT **EQUIPM CLOTH OPERA** ANTI-THEFT ALARM COMFORT SEATS LUMBER SUPPORT MULTI FUNC INDICATOR OIL LEVEL GAUGE **ILLUM SUN VISORS** FRONT CENTRE ARMREST REAR CENTRE ARMREST **ALTERNATOR 140A GEARBOX 5 SPEED** CRUISE CONTROL TYRES 195/65 HR 15 WHEELS 6.5J X 15 ALU SPACE SAVER SP-WHEEL **DECORATION ANTHRACIT**

STABILITY PROGRAM 1.9 LTR 77 KW TWO COAT METALLIC

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Severity of Impact: Good Steering Rim Ply: Satisfactory Vehicle Status on Inspection: Mobile

Medium

KILBURN, LONDON NW6 2QX TEL: 0207 3722222 FAX: 0207 3727464

Assessment Number: MF003949 Full Report

Version: admirecv/2 Printed: 02/05/2015

Brakes Pedal Travel: Satisfactory Date of Inspection: 30/04/2015

Place of Inspection: Repairer

Pre-Accident Damage: VARIOUS MINOR DAMAGE


Tyres Condition: Good


Tyres - Tread Depth (MM):


Left Tyre Right Tyre
Axles Depth Depth

LHF 0 4.0 4.0 RHF LHR 1 4.0 4.0 RHR

Damage Areas:



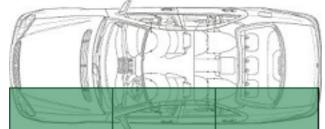

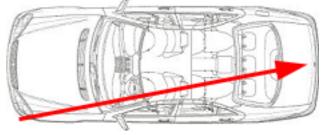

KILBURN, LONDON NW6 2QX TEL: 0207 3722222 FAX: 0207 3727464

Assessment Number: MF003949 Full Report

Version: admirecv/2 Printed: 02/05/2015

Addresses

Assessor

MIKE FERREIRA A B DYNE MOTORS LIMITED 52 IVERSON ROAD LONDON

NW6 2QX

Business Tel: 0207 372 2222 Fax Tel: 0207 372 7464

Repairer

Fix Auto West Hampstead 52 Iverson Road West Hampstead London NW6 2QX

Business Tel: 0207 372 2222 Fax Tel: 0207 3727464 **Insured**

MR MATTHEW JENNINGS RAFWYTON RAF BRAMPTON

PE28 2EA

Mobile Tel: 07792874764

Insurer

Admiral Capital tower Greyfriars Road

Cardiff CF10 3AZ

Business Tel: 0844 543 4400 Fax Tel: 0870 013 0170

Vehicle Location

fix west hamppstead

Cost Summary

Total Labour £1,429.10 Total Paint/Material £579.49 **Total Parts** £1,490.58 Additional Costs £133.30 Grand Total Exc VAT: £3,632,47 20 % VAT: £726.49 Grand Total Inc VAT: £4,358.96 Excess: £250.00

Total Loss Details

Salvage Agent:

Registration Month:

Odometer: 69169 M

September 69169 Miles Registration Year: Pre Accident Value: 2006

Repair Information

LABOUR Time Basis 10 WU = 1 HR. Price = £31.00/HR

Repair / Guide

Number	Description	Work Units
51 01 75 01)	RUST PROOFING BODY SHELL PART	2.0
51 01 75 50	APPLY RUST PROOFING AT LEFT A-PILLAR	1.0
	(COMPOSITE WORK)	
51 01 75 50	APPLY CAVITY SEALING ON L/R DOOR	1.0
	(COMPOSITE WORK)	

KILBURN, LONDON NW6 2QX

TEL: 0207 3722222 FAX: 0207 3727464

Assessment Number: MF003949 Full Report Version: admirecv/2 Printed: 02/05/2015

51 01 75 50	APPLY RUST PROOFING AT LEFT SILL PANEL	1.0
	(COMPOSITE WORK)	
51 01 03 00	BODY ALIGNMENT ON CHASSIS JIG	11.0
	INCLUDES: ON + OFF BODY SHELL WITH CAR	
	HOIST, REBUILD CHASSIS JIG	
3 29 19 00	R + R FRONT BUMPER COVER	7.0
	INCLUDES: R + R RADIATOR GRILLE	
33 30 19 00	R + R FRONT BUMPER PROTECTIVE MOULDING/S	2.0
66 04 19 00	R + R FRONT VENTILATION GRILLE	2.0
0 55 19 50	R + R LEFT FRONT WING	7.0
	(BUMPER COVER REMOVED)	
	INCLUDES: R + R WHEEL AND WHEELHOUSE	
	SHELL	
66 16 19 50	R + R R/F WHEELHOUSE SHELL	2.0
	(WHEEL REMOVED)	
94 15 20 50	R + R BOTH HEADLAMPS	3.0
	(RADIATOR GRILLE AND FRONT PROTECTIVE	
	MOULDINGS REMOVED)	
	DOES NOT INCLUDE: ADJUST HEADLAMPS	
4 15 16 00	ADJUST HEADLAMPS	2.0
2 66 20 00	R + R L/- AND R/WASHER NOZZLE	2.0
0 55 51 50	L/F WING SEAL (COMPOSITE WORK)	3.0
94 15 55 50	RENEW L/HEADLAMP	1.0
	(HEADLAMP REMOVED)	
(N	R + R L/- AND R/COVER MOULDING	2.0
7 51 55 60	RENEW L/F DOOR	33.0
	(REMOVED)	
	INCLUDES: R + R ALL PARTS,	
	RENEW OUTER DOOR SKIN IF NECESSARY	
58 51 19 00	R + R LEFT REAR DOOR	3.0
8 39 19 50	REMOVE AND REFIT L/R DOORSKIN	5.0
	(DOOR HANDLE REMOVED)	
58 39 55 50	RENEW L/R DOOR SKIN	5.0
	(DOOR SKIN REMOVED)	
8 11 19 00	R + R LEFT REAR DOOR HANDLE	2.0
4 68 19 50	R + R L/R OUTER DOOR CHANNEL SEAL	1.0
	(DOOR SKIN REMOVED)	
51 45 53 00)	REMOVE PARTS L/F OUTER LOWER SILL	6.0
,	(WING, BUMPER COVER, INNER SILL	
	MOULDING, REAR SEAT AND IF NECESSARY	
	SIDE TRIM REMOVED)	
	INCLUDES: REMOVE FRONT DOOR, FRONT SEAT	
	BELT, FRONT SEAT AND DOOR HINGE	
51 45 55 00	RENEW L/F OUTER LOWER SILL	42.0
51 45 59 00)	KENEW EJT OOTEK EOWER SILE	
11 43 33 00)	FIT PARTS L/F OUTER LOWER SILL	15.0
01 43 39 00)		
11 +3 33 00)	FIT PARTS L/F OUTER LOWER SILL INCLUDES: FIT REMOVED PARTS, RENEW IF NECESSARY,	
1 43 39 00)	FIT PARTS L/F OUTER LOWER SILL INCLUDES: FIT REMOVED PARTS, RENEW IF NECESSARY, ADJUST FRONT DOOR	
	FIT PARTS L/F OUTER LOWER SILL INCLUDES: FIT REMOVED PARTS, RENEW IF NECESSARY, ADJUST FRONT DOOR DOES NOT INCLUDE: RENEW FRONT DOOR	15.0
68 05 19 60	FIT PARTS L/F OUTER LOWER SILL INCLUDES: FIT REMOVED PARTS, RENEW IF NECESSARY, ADJUST FRONT DOOR	

KILBURN, LONDON NW6 2QX

TEL: 0207 3722222 FAX: 0207 3727464

Assessment Number: MF003949 Full Report Version: admirecv/2 Printed: 02/05/2015

	Total Work Units Total Panel / Mechanical Labour	29.00 HRS	290.0 £899.00
,001	CHECK LY WHELE DEAKING 1150		
7047	CHECK L/F TRACK CONT ARM CHECK L/WHEEL BEARING HSG		
7047	CHECK L/F TRACK CONT ARM		10.0
1000	REPAIR Miracle pull set up		10.0*
1000	Repair PULL L/SIDE PANELS		10.0*
3481	REPAIR L/R SIDE PANEL		20.0*
2583	REPAIR REAR BUMPER		10.0*
2263	REPAIR L/OUT/UPP A-PILLAR		10.0*
2239	REPAIR L/OUT/LWR A-PILLAR		20.0*
0471	REPAIR BONNET		10.0*
0737	(COMPOSITE WORK) (VEHICLE FRONT AND REAR ALIGNMENT) REMOVE&REFIT ROOF AERIAL ROD		2.0*
44 93 15 50	REAR WHEEL TOE ALIGNMENT		2.0
	(COMPOSITE WORK) (FRONT AND REAR VEHICLE ALIGNMENT)		
44 94 15 50	REAR WHEEL CAMBER ALIGNMENT		2.0
44.04.15.50	(VEHICLE FRONT AND REAR ALIGNMENT)		2.0
	(COMPOSITE WORK)		
44 88 15 50	FRONT WHEEL TOE ALIGNMENT		2.0
	CARRIER		
	INCLUDES: DETACH + REFIT ASSEMBLIES		
	(FRONT AND REAR ALIGNMENT)		
44 89 15 50	ADJUST FRONT CAMBER (COMPOSITE WORK)		3.0
	DOES NOT INCLUDE: ADJUSTMENT		
	R + R BRACKET AND ALIGNMENT SENSOR		
11 93 03 00	INCLUDES: CHECK TOE AND CAMBER,		5.0
44 95 03 00	ALIGN FRONT AND REAR VEHICLE		9.0
44 05 19 00	R + R REAR WHEEL (WHEELS)		2.0
	BALANCE WHEEL		
	(WHEEL REMOVED) INCLUDES: R + R TYRES, FIT VALVE AND		
44 10 55 50	RENEW LEFT FRONT WHEEL/TYRE		2.0
44.10 FF F0	INCLUDES: PROGRAM RADIO		2.0
KN	DETACH + REFIT BATTERY		2.0
ZNI	(BUMPER COVER REMOVED)		2.0
66 59 19 50	R + R REAR LOWER SPOILER		2.0
66 50 40 50	INCLUDES: R + R TAILLAMPS		
63 69 19 00	R + R REAR BUMPER COVER		7.0
	(WHEEL REMOVED)		
	R + R L/R WHEELHOUSE SHELL		

PAINT WORK Time Basis 10 WU = 1 HR. Price = £31.00/HR

Repair / Guide Description

Number TWO COAT METALLIC Work Units

KILBURN, LONDON NW6 2QX TEL: 0207 3722222 FAX: 0207 3727464

Assessment Number: MF003949 Full Report

Version: admirecv/2 Printed: 02/05/2015

	Total Paintwork Labour	17.1 HRS.	£530.10
	Total Work Units		171.0
	PREPARATION FOR PRE-PAINTING		30.0
1000	STONECHIP SILL Paint < 50%		5.0 *
1000	FRONT SCREEN MASK		5.0*
1000	SILL REFURB X 2 Paint < 50%		10.0*
742	R/F WING SURFACE PAINT		6.0
3481	L/SIDE PANEL REPAIR PAINTING <50%		14.0
2583	REAR COVER BUMPER REPAIR PAINT PLASTIC		12.0
2239	LEFT A-PILLAR REPAIR PAINTING <50%		8.0
471	BONNET REPAIR PAINTING <50%		23.0
2113	L/F SILL PANEL NEW PART PAINTING		20.0
1785	UK UPLIFT L/R DOORSKIN		5.0+
1785	L/R DOORSKIN NEW PART PAINTING		13.0
1501	L/F DOOR NEW PART PAINTING		10.0
741	L/F WING NEW PART PAINTING		10.0

MATERIAL COST - PAINT	COST
Total Paint Cost	£693.59
Sundry Paint Material	£52.05
Pre-Painting Sundry Materials	£27.01
Total Excluding Pearlescent Uplift	£772.65
Pearlescent Uplift @ 0.0%	£0.00
Discounted by 25%	-£193.16

PARTS

Price Valid: 27/03/2015

£579.49

Guide No.	Description	Part Number	Bet.	Held Date	Price
297	L/F AIR GUIDE GRILLE	1K0 853 665 9B9	0%		£20.66
561	LEFT HEADLAMP ASSY	1K6 941 029 Q	0%		£133.66
741	L/F WING	1K6 821 021 A	0%		£120.94
841	L/F W-HOUSE RR COVER	1K0 805 977 B	0%		£26.63
843	L/F W-HOUSE FRT CVR	1K0 805 911 F	0%		£26.63
1487	L/F UPPER DOOR HINGE	1K0 831 401 N	0%		£13.28
1495	L/F LOWER DOOR HINGE	1K0 831 411 Q	0%		£33.02
1501	L/F DOOR FRAME	1K4 831 301 AB	0%		£162.58
1509	L/F OUTER DOOR SEAL	1K4 837 701 E 9B9	0%		£36.00
1513	L/F DOOR FOIL	AKL 433 014 02	0%		£7.04
1519	L/F DOOR GLASS	1K4 845 201 B	0%		£58.40
1531	L/F RETAIN RAIL REAR	1K4 831 299 G	0%		£39.19

Total Paint And Material Cost

KILBURN, LONDON NW6 2QX TEL: 0207 3722222 FAX: 0207 3727464

Assessment Number: MF003949 Full Report

Version: admirecv/2	Printed: 02/05/2015

1533	L/F RETAIN RAIL FRT	1K0 831 389 A	0%	£33.96
1535	L/F DOOR COVER REAR	1K4 837 381 D 5AP	0%	£12.64
1545	L/F DOOR 1-PACK ADH	DH 009 100	0%	£24.54
1625	L/F OUT CHANNEL MLDG	1K4 837 477 D 5AP	0%	£17.33
1655	L/F DOOR TRIM	1K4 837 901 A 03C	0%	£12.33
1681	L/F DOOR MOULDING	1K4 853 515 B 9B9	0%	£18.26
1701	L/F IMPACT CARRIER	1K4 831 505 D	0%	£37.93
1735	L/DOOR MIRROR COVER	1K0 857 537 A 9B9	0%	£22.29
1737	L/DOOR MIRROR	1K2 857 507 AA 9B9	0%	£192.24
1743	L/DOOR MIRROR GLASS	5M0 857 521 E	0%	£37.70
1785	L/R DOORSKIN	1K6 833 105 J	0%	£129.51
1789	CLEANING SOLUTION	D 009 401 04	0%	£25.68
1791	PRIMER	D 009 200 02	0%	£7.33
1793	APPLICATOR	D 009 500 25	0%	£2.60
1831	L/R RETAIN RAIL REAR	1K6 833 299 J	0%	£39.19
1833	L/R RETAIN RAIL FRT	1K6 833 389 A	0%	£33.96
1845	L/R DOOR 1-PACK ADH	DH 009 100	0%	£24.54
1981	L/R DOOR MOULDING	1K4 853 753 9B9	0%	£14.94
2099	L/SIDE FRAME	1K4 809 835 B	0%	£160.17
2605	REAR BUMPER SPOILER	1K6 807 521 9B9	0%	£60.55

 Sub Total
 £1,585.72

 Deduction from RRP
 (6 %)
 -£95.14

 Sundry Parts
 £0.00

 Total Parts
 £1,490.58

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras				
	Description		Betterment	Price
	E.P.A. CHARGE	Specialist	0%	£5.00
	SOUND PAD X2	Specialist	0%	£7.00
	SYSTEM CHECK	Specialist	0%	£35.00
	WHEEL BALANCE X1	Specialist	0%	£3.50
	WHEEL REFRUB n/s/f		0%	£65.00
	fine masking	Specialist	0%	£5.00
			Total Extras	£120.50

Calculation			30/04/2015
Labour			
	Total Panel/Mechanical	£899.00	
	Total Paintwork	£530.10	
Total Labour			£1,429.10
Total Paint/Material			£579.49

KILBURN, LONDON NW6 2QX TEL: 0207 3722222 FAX: 0207 3727464

Assessment Number: MF003949 Full Report

Version: admirecv/2 Printed: 02/05/2015

Costs

Total Parts £1,490.58

Additional Costs

Corrosion Protection Materials External £12.80

Cost of Specialist £120.50

Total Additional Costs £133.30

Grand Total Excl VAT VAT @ 20 % £3,632.47

VAT @ 20 % £726.49
Grand Total Incl VAT £4,358.96

Excess £250.00

Assessment Notes

No assessment notes entered.